

Date: Monday, 5/7/2007 9:56:25 AM
 User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: HIGH AFT X-TUBE 412
Job Number	: 32227		
Estimate Number	: 10559		
P.O. Number	: N/A	Part Number	: D412664203
This Issue	: 5/7/2007 S.O. No. : N/A	Drawing Number	: D412-664-243 REV D
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: N/A Type : LANDING GEAR	Drawing Revision	: D
Previous Run	: 32226	Material	: N/A
Written By	: <u>4807.05.07</u>	Due Date	: 6/10/2007 Qty: 1 Um: Each
Checked & Approved By	: <u>4807.05.07</u>		
Comment	Est Rev:E 04.02.16 Reformat; Added D3189-1 K/DS Est Rev:F 06-03-29 Remove Comments on Pick List JLM Est Rev:G 06.12.08 per ECN 886 EC Est Rev:H 07-04-30 As per Rev D JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D412-664-203 CHG 006

48 07.05.30

2.0	D6009129	Crosstube Material
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6009-129 Crosstube 26548

Check OD = 3.500"; ID = 2.250"

36 07.06.06 (1)

3.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA166

2-Turn first side as per Folio FA166

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D412-664-243.

36 07.06.06 (1)

4.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------



Comment: INSPECT ALL DIM TO DIM SHEET

36 07.06.06 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 5/7/2007 9:56:25 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH AFT X-TUBE 412

Job Number: 32227

Part Number: D412664203

Job Number:



Seq. #:

Machine Or Operation:

Description:

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA166

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D412-664-243.

3- Remove sand and plugs

4-Scribe part # and batch # using vibrating stylus as per Dwg D412-664-243

Inside of

Cuff(Donot engrave on outside of tube)

RC 02-06-06

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

RC 67-06-06

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

J.L 07/06/06

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Polish entire outside surface of crosstube

EL 7-6-6

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP 2-6-7

10.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

EL 7-6-7

11.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: Inspect work & Chemical conversion Coat

pm 07-07-05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 5/7/2007 9:56:25 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH AFT X-TUBE 412

Job Number: 32227

Part Number: D412664203

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per Dwg D412-664-243 using CNC bender program 412-af and Folio FT010

EL 7-7-12

13.0

QC15

DIMENSIONAL CHECK OF X-TUBES



Comment: DIMENSIONAL CHECK OF X-TUBES

En 07/07/12 (41)

14.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551

2-Ream hole to finish size in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D412-664-243

070717
JO 7-7-24

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

JO 7-7-24

16.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

En 07/07/26 (41)

17.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

En 07/07/26 (41)

18.0

OUTSIDE SERV.10

OUTSIDE SERVICES -LG



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 038 Or

Issue P/O: 4266 LPI as per ASTM 1417

Level 2 Attach copy of NDT results to work order

u 07.07.27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 5/7/2007 9:56:25 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH AFT X-TUBE 412

Job Number: 32227

Part Number: D412664203

Job Number:



Seq. #:

Machine Or Operation:

Description :

19.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Inspect for transit damage

Ensure copy of NDT results attached to work order.

20.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: Inspect for damage & ensure results are as per Dwg D412-664-203

21.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2

22.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

Wrap in plastic bag to protect from scratches

23.0

D3595

Rubber Cushion (per sq ft)



Comment: Qty.: 0.0492 sf(s)/Unit Total : 0.0492 sf(s)

Rubber Cushion (per sq ft)

.630" x5.70" x2pcs

Batch:

33835

AT 07-08-16

24.0

D2856600

Abrasion Strip



Comment: Qty.: 1.7640 f(s)/Unit Total : 1.7640 f(s)

Pick:

Qty Part number Description Batch

2 D2856-600(Cut to 10.090") Abrasion Strip

26650

ml 07 08 15

25.0

D28961

Support



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D2896-1

Support

30200

ml 07 08 15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 5/7/2007 9:56:25 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH AFT X-TUBE 412

Job Number: 32227

Part Number: D412664203

Job Number:



Seq. #:

Machine Or Operation:

Description :

26.0

D31891

Chafing Shield



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D3189-1 Chafing Shield

33561

ml 070815

27.0

MS2192028

Clamp(per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch

4 MS21920-28 Clamp

103896

ml 070815

28.0

MS2192030

clamp(per MIL-DTL-8783C)



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

clamp(per MIL-DTL-8783C)

batch: 100154

ml 070815

29.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Assemble as per Dwg D412-664-203

1-Install supports with magnobond as per QSI 015 Adhere for for 12 Hrs

A/R 6398 Magnobond

Batch: 104723

Expiry Date: ~~10/16/08~~ 10/2008

Time: 2:00pm

ml 070815

2-Install clamps as per Dwg D212-664-141. Torque clamps to 80-100 in lb.

30.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Ep 07/08/20

31.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 5/7/2007 9:56:25 AM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH AFT X-TUBE 412

Job Number: 32227

Part Number: D412664203

Job Number:



Seq. #:

Machine Or Operation:

Description :

32.0

AN640A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M104394

50

33.0

AN641A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: M100743

50

34.0

AN960JD616

Washer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Washer

Batch: M104374

59

35.0

MS21042L6

Nut



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Nut

Batch: M101660

7/8/20

50

36.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

Er 07/08/20

37.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D412-664-203

*****Ensure tube is not packaged if curing time is less than 12 hrs, see step 27 for application time & date

Time & date of packaging: 07/08/20 9:00 am.

Location: G

PPP Rev: G

EP 07/08/20 @

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: D Date: 07/08/09
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: : Monday, 5/7/2007 9:56:25 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH AFT X-TUBE 412

Job Number: 32227

Part Number: D412664203

Job Number:



Seq. #:

Machine Or Operation:

Description :

38.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

①
FD 07/08/29

Job Completion



LL 07-08-20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: 32227
Description: Crosstube Assembly (412 High Aft)	Part Number: D412-664-243
Inspection Dwg: D412-664-243 Rev: B 0 04 07 07	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Inspection Sheet Drawing Dimension		Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.684	+0.005/-0.000	2.686	✓			
	2.748	+0.005/-0.000	2.752	✓			
	2.884	+0.005/-0.000	2.888	✓			
	3.019	+0.005/-0.000	3.023	✓			
	3.163	+0.005/-0.000	3.167	✓			
	3.308	+0.005/-0.000	3.312	✓			
	3.429	+0.005/-0.000	3.433	✓			
	2.990	+0.005/-0.000	2.994	✓			
	2.618	+0.005/-0.000	2.622	✓			
	0.200	+/-0.010	.200	✓			
	R0.063	+/-0.010	.063	✓			
	R0.500	+/-0.010	.500	✓			
	4.971	+/-0.001	4.971	✓			
SIDE B	2.684	+0.005/-0.000	2.688	✓			
	2.748	+0.005/-0.000	2.752	✓			
	2.884	+0.005/-0.000	2.888	✓			
	3.019	+0.005/-0.000	3.023	✓			
	3.163	+0.005/-0.000	3.167	✓			
	3.308	+0.005/-0.000	3.312	✓			
	3.429	+0.005/-0.000	3.433	✓			
	2.990	+0.005/-0.000	2.994	✓			
	2.618	+0.005/-0.000	2.622	✓			
	0.200	+/-0.010	.200	✓			
	R0.063	+/-0.010	.063	✓			
	R0.500	+/-0.010	.500	✓			
	4.971	+/-0.001	4.971	✓			
	124.09	+/-0.020	124.09	✓			

Measured by: JSC	Audited by: J.L.	Prototype Approval:	N/A
Date: 07-06-06	Date: 07/06/06	Date:	N/A


Rev	Date	Change	Revised by	Approved
A	04.06.16	New Issue (P/O D412-664-203)	KJ/JLM	
B	06.03.09	Dwg Rev updated	KJ/JLM	

DART AEROSPACE LTD		Work Order:	32227
Description: Crosstube High Aft (412)		Part Number:	D412-664-203
Inspection Dwg: D412-664-243 Rev: <i>CD</i>		Page 1 of 1	

07.04.07

Required Dimension	Min	Max
Height	24.24 24.31	24.43
1/2 Span	53.59 53.66	53.78
Angle	49	52
Total Span	107.13 107.32	107.56

24.50
53.35
107.70
} *07.04.07*

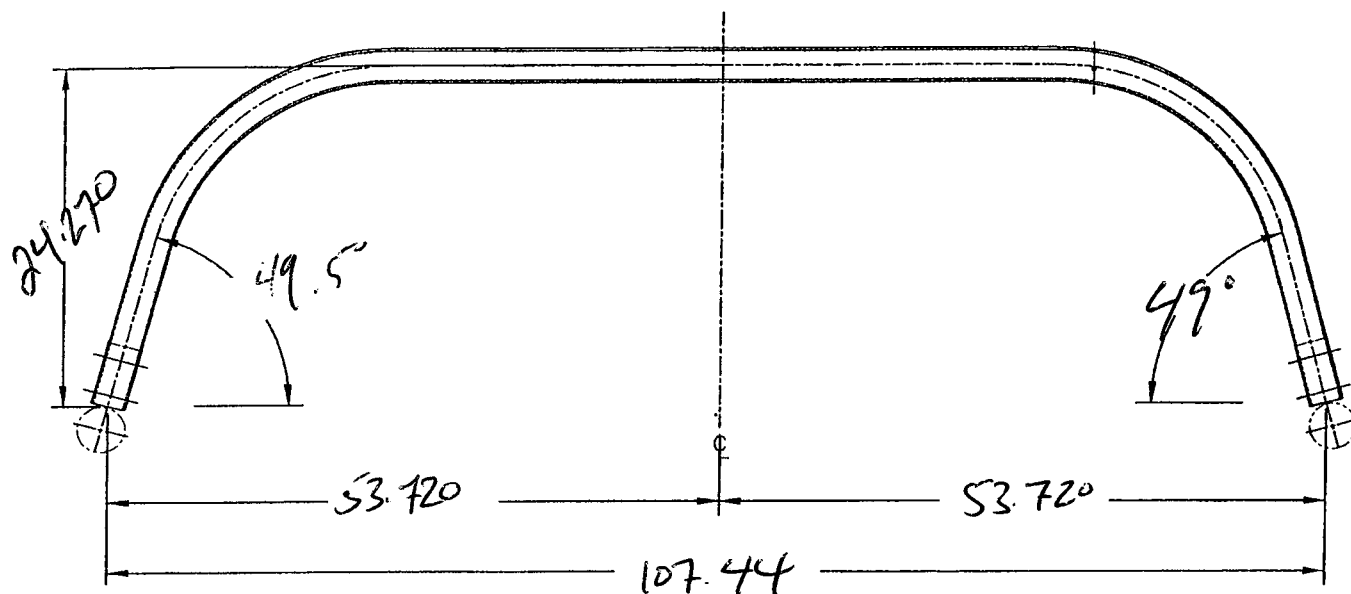

Comments
<i>tube is symmetrical</i>

QC15 Inspection	<i>En</i>
Date	<i>07/07/17</i>

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM <i>[Signature]</i>	<i>[Signature]</i>

DART

DESIGN PH	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED GP	APPROVED [Signature]	DRAWING NO. D412-664-243	REV. D SHEET 1 OF 3
DATE 07.03.09		TITLE CROSSTUBE ASSEMBLY (412 HI AFT) NTS	
A	01.10.17	NEW ISSUE	
B	05.02.04	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	
C	06.10.27	REMOVE D2856-600-1087, ADD D2732-058 & MAGNOBOND 6398 MS21920-32 WAS MS21920-30	
D	07.03.09	REMOVE D2732-058, CHANGE TO D3595-063-570	

RELEASE07.04.24 **[Signature]**

Qty	Part Number	Description
X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
1	D6009-129	CROSSTUBE
2	D3595-063-570	RUBBER CUSHION
1	D2896-1	SUPPORT
2	D2856-600-1009	ABRASION STRIP
4	MS21920-28	CLAMP
2	MS21920-30	CLAMP (OR MS21920-32)
2	D3189-1	CHAFING SHIELD
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)





GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6009-129
FINISHED LENGTH = 124.09±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-600-1009 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) APPLY A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 12) INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE SUPPORT.
- 13) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.



SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. **32227**

Copyright © 2001 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

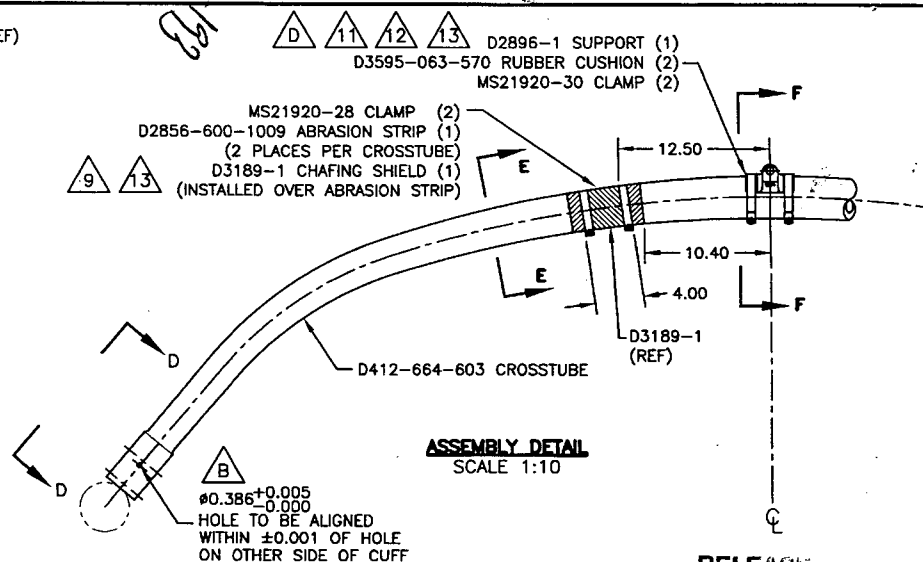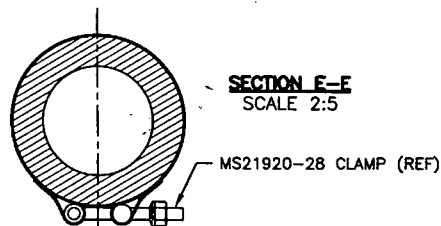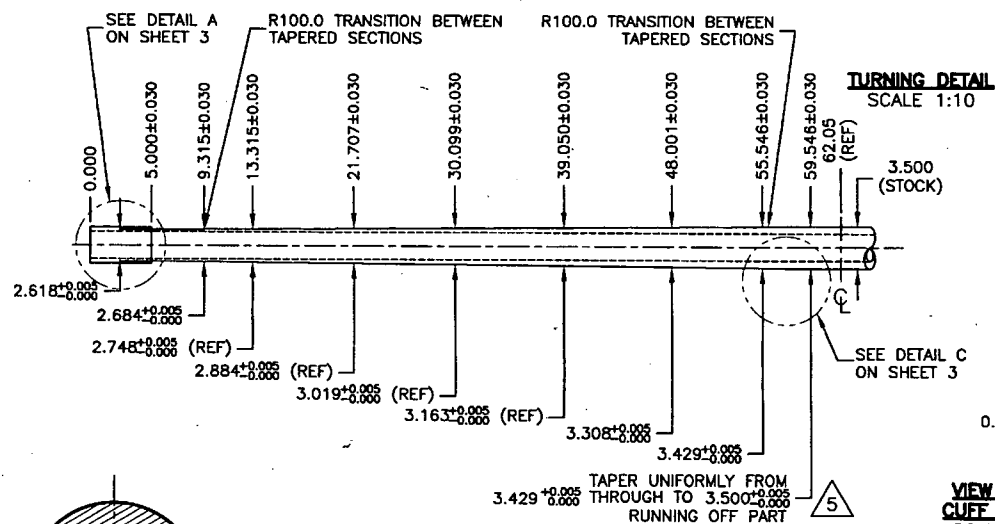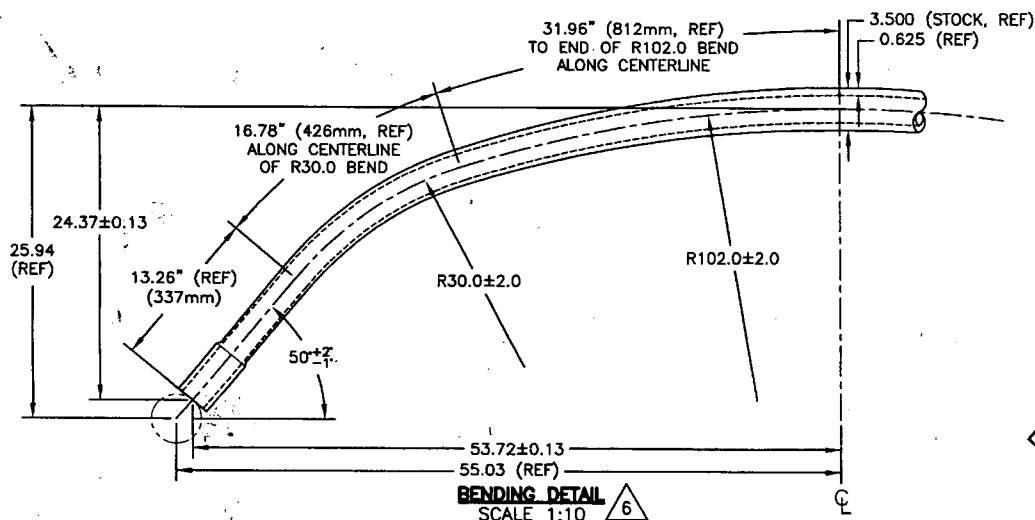

RELEASE
07.04.24

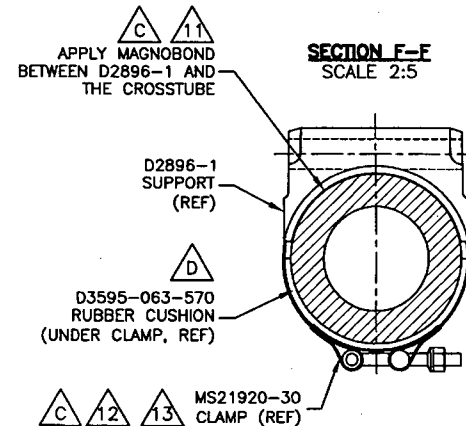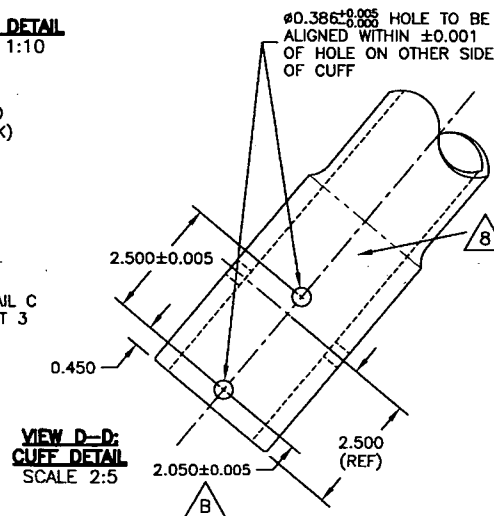

COPYRIGHT © 2001 BY DART AEROSPACE LTD.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	PH	DRAWN BY	PH	DART	DART AEROSPACE LTD. WINDSOR, ONTARIO, CANADA
CHECKED	GP	APPROVED	PH	DRAWING NO. D412-664-243	REV. 0 SHEET 2 OF 3
DATE	07.03.09	TITLE	CROSSTUBE ASSEMBLY (412 HI AFT)	SCALE	1:10


NO. 22227
WORK ORDER
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE/
ENGINEERING
RETURN TO
SHOP COPY

RELEASED
07-04-244P
REF ECU 897


DETAIL A: CROSSTUBE CUFF

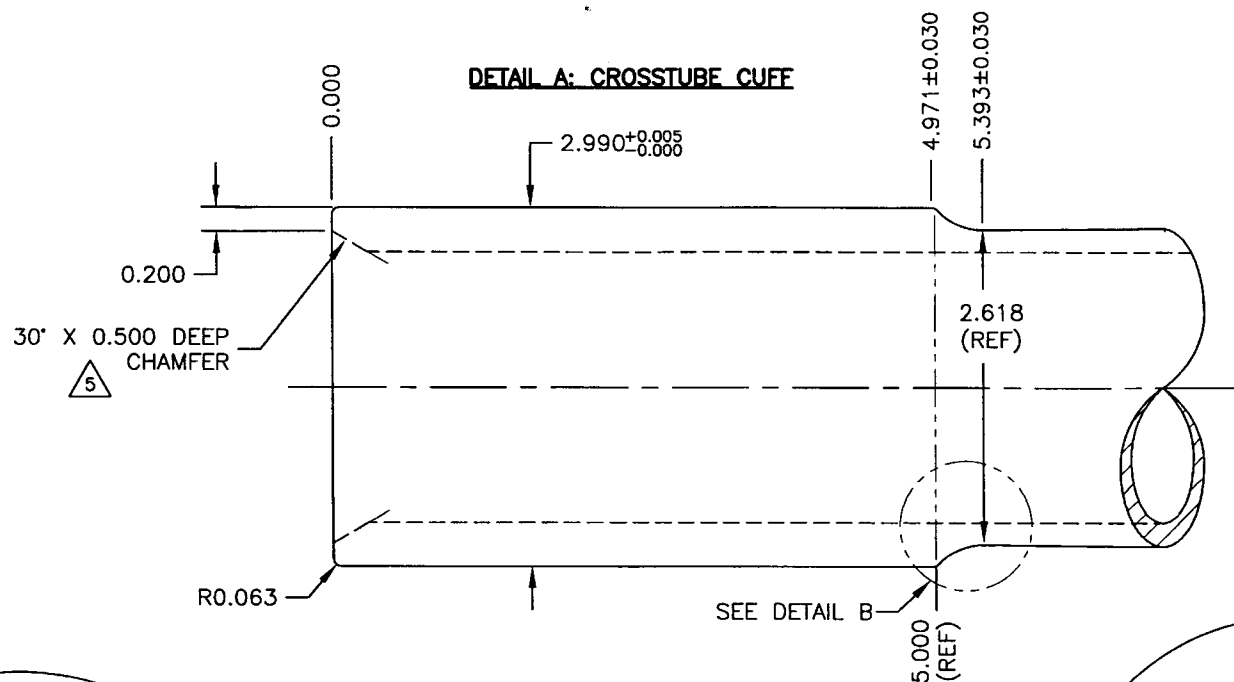

**DETAIL B: CUFF
TRANSITION
SCALE 4:1**

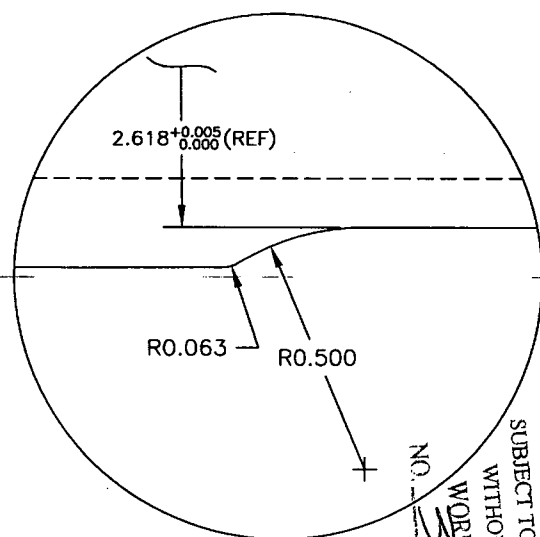

**DETAIL C:
TAPER RUN-OFF
NOT TO SCALE**

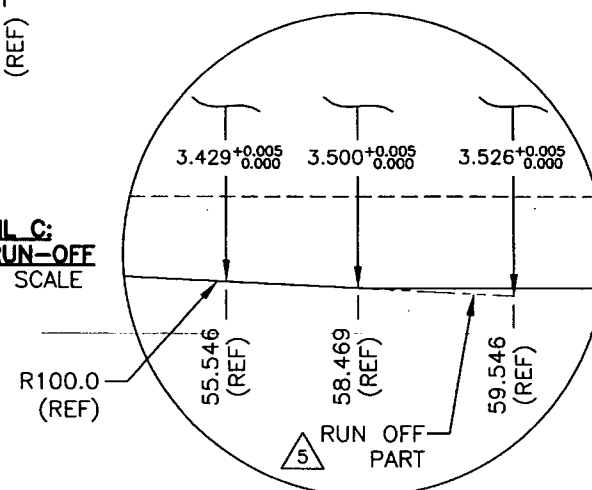


NO. 32227
WORK ORDER
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2001 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN PH	DRAWN BY PH	DART DART AEROSPACE LTD. WILMINGTON, ONTARIO, CANADA	REV. D
CHECKED J	APPROVED J	DRAWING NO. D412-664-243	SHEET 3 OF 3
DATE 07.03.09	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	SCALE 1:1	

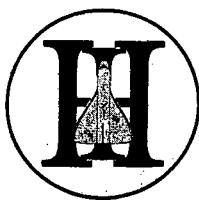

HeathAir

INTERNATIONAL (1991) INC.

681 Ave. Lepine, Dorval, Québec H9P 1G3
Tél.: (514) 636-1000 • Fax: (514) 636-0031

W.O. N° 37039

A.M.O. Number: 46/90

NON-DESTRUCTIVE TESTING REPORT

AIRCRAFT / COMPONENT INFORMATION

REGISTRATION:

MODEL/TYPE:

SERIAL NUMBER:

TOTAL HR/LDG:

OPERATED BY:

BASED AT:

INSPECTION REQUIREMENTS

Carry out FPI of six (6) cross tubes (external surface) as per ASTM E-1417-05 and the Dart QSI 038, Section 4.1.1 (on file at client) - parts delivered to HeathAir.

Qty. (1) P/N D212-664-201

S/N B32680

Qty. (2) P/N D212-664-101

S/N's B32673 & B32674

Qty. (3) P/N D412-664-203

S/N's B32228, B32226 & B32227



RADIOGRAPHY



ULTRASONIC



PENETRANT



MAGNETIC PARTICLE



EDDY CURRENT

INSPECTION REPORT

Fluorescent penetrant inspection was performed in accordance with the above requirements on six (6) cross tubes.

Note: A Level 3 penetrant was substituted for the requested Level 2 (3 is more sensitive)
Ardrox 970P25E Batch #04B503.

Six (6) cross tubes PASSED inspection.

THE MAINTENANCE DESCRIBED ABOVE HAS BEEN PERFORMED IN ACCORDANCE WITH
THE APPLICABLE STANDARDS OF AIRWORTHINESS

INSPECTED BY:

S. FLETCHER

DATE August 1, 2007

INSPECTION
STAMP(S) Not Required

CUSTOMER INFORMATION

CUSTOMER Dart Aerospace

P.O. NUMBER

4266

ADDRESS:

CONTACT NAME:

LABOUR

@

\$

MATERIALS

@

TRAVEL EXPENSES

@

GST

HOTEL EXPENSES

@

PST

INVOICE NO.

TOTAL \$

WHITE COPY - INSPECTION FILE • YELLOW COPY - CUSTOMER • PINK COPY - ACCOUNTANT

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	
A0813	20.1	Strip X-tubes to remove paint & primer.	JD	070813	1	QS1042	A08-13	
		Polish tubes to remove circumferential marks, by polishing longitudinally with a barrel grinder.	JD	7-8-13	1			
		Inspect the surface finish	20708-13 ①	2	070813			1
		Apply Chemical conversion coat per QS1005 4.1	JD	7-8-13	1			
		Proceed with step 21.0	N/A	→				

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: D Date: 07/08/29
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries